



MATERIALS TESTING, INC.

55 LAURA STREET • NEW HAVEN, CONNECTICUT 06512 • (203) 468-5216
42 BOSTON POST ROAD • WILLIMANTIC, CONNECTICUT 06226 • (860) 423-1972

DATE: 10-16-15

REPORT: M-1081

CLIENT: McClure Construction Co.
PO Box 367
Waterford, CT 06385


PROJECT: Client's Information

SUBJECT: WASHED SIEVE ANALYSIS (ASTM C-136, D1140)

Material: 1 ¼" Processed Gravel

Source: Waterford Pit

Sampled: by client and delivered to MTI on 10/8/15

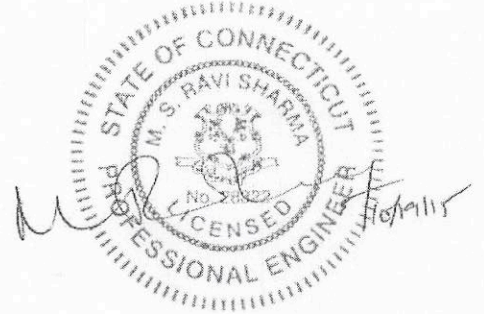

Sieve Size	Percent Passing
2 ½" (63.5mm)	100
2" (50mm)	100
1 ½" (37.5mm)	100
1" (25mm)	97
¾" (19mm)	87
½" (12.5mm)	77
⅜" (9.5mm)	72
¼" (6.3mm)	65
#10 (2.0mm)	49
#20 (850µm)	37
#40 (425µm)	27
#100 (150µm)	12
#200 (75µm)	4.8

A material specification was not provided at this time.

Materials Testing, Inc.
Richard C. Kearns

William J. Soucy

1cc: Client
1cc: J McClure

wlb