



# MATERIALS TESTING, INC.

55 LAURA STREET • NEW HAVEN, CONNECTICUT 06512 • (203) 468-5216  
42 BOSTON POST ROAD • WILLIMANTIC, CONNECTICUT 06226 • (860) 423-1972

DATE: 03-03-16

REPORT: M-1084

**CLIENT:** McClure Construction Co.  
PO Box 367  
Waterford, CT 06385

**PROJECT:** Client's Information

**SUBJECT:** SIEVE ANALYSIS (ASTM C-136)

**Material:** Stone Laboratory Blend 50% 3/4", 25% 1/2", 25% 3/8"

**Source:** McClure Pit


**Sampled:** by client and delivered to MTI 2/26/16 and 3/2/16.

Sieve Size	Percent Passing	State of CT Dept of Transportation Form 816 M.01.01 Size #67
1" (25mm)	100	100
3/4" (19mm)	93	90-100
1/2" (12.5mm)	47	-
3/8" (9.5mm)	23	20-55
#4 (4.75mm)	2	0-10
#8 (2.36mm)	1.3	0-5

This material as sampled and laboratory blended meets the above listed graduation.

Materials Testing, Inc.  
Richard C. Kearns

William J. Soucy

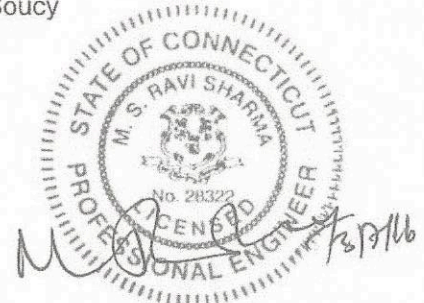

1cc: Client  
1cc: J McClure

eaw